

Compliance: Required as indicated, unless accomplished previously.

To prevent leakage of the parking brake operated valve (PBOV) and consequent failure of the "blue" hydraulic system and alternate parking brake and emergency braking systems, which could affect elements of the hydraulics for flaps, stabilizer, certain spoilers, elevator, rudder, and aileron, accomplish the following:

Restatement of Requirements of AD 2002-08-12, Amendment 39-12720

Inspections/Follow-On Actions

(a) Within 7 days after May 8, 2002 (the effective date of AD 2002-08-12): Do a one-time detailed inspection to determine the part number (P/N) and serial number (S/N) of the PBOV of the main landing gear, according to Airbus Service Bulletin A330-32A3139 (for Model A330 series airplanes) or A340-32A4176 (for Model A340 series airplanes), both Revision 01, dated November 23, 2001; as applicable.

(1) If no P/N or S/N is identified as affected equipment according to the applicable service bulletin, no further action is required by this AD.

(2) If any P/N or S/N is identified as affected equipment according to the applicable service bulletin: Before further flight, perform the follow-on actions (which may include a visual inspection for hydraulic fluid leakage at the PBOV, repair or replacement of the PBOV with a new or serviceable part if leakage is found, and an operational test) according to the applicable service bulletin. If the affected PBOV is not replaced, or if the PBOV is replaced with a part having the same P/N or S/N, repeat the inspection thereafter at the time specified by and according to the service bulletin, as applicable, until the part is replaced.

Note 2: For the purposes of this AD, a detailed inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

New Requirements of this AD

PBOV Modification/Replacement

(b) Within 10 months after the effective date of this AD: Modify affected PBOVs, or replace them with new PBOVs, according to Airbus Service Bulletin A330-32A3139 (for Model A330 series airplanes) or A340-32A4176 (for Model A340 series airplanes), both Revision 01, dated November 23, 2001, as applicable. This modification terminates the requirements of this AD.

(c) Accomplishment of the actions before the effective date of this AD according to Airbus Service Bulletin A330-32A3139 or A340-32A4176, dated September 14, 2001, as applicable, is acceptable for compliance with the requirements of paragraphs (a) and (b) of this AD.

Alternative Methods of Compliance

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

Special Flight Permits

(e) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Note 4: The subject of this AD is addressed in French airworthiness directives 2001-516(B) R1 and 2001-517(B) R1, both dated February 6, 2002.

Issued in Renton, Washington, on August 9, 2002.

Vi Lipski,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 02-20712 Filed 8-15-02; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2001-NM-250-AD]

RIN 2120-AA64

Airworthiness Directives; Bombardier Model CL-600-2B19 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Supplemental notice of proposed rulemaking; reopening of comment period.

SUMMARY: This document revises an earlier proposed airworthiness directive (AD), applicable to certain Bombardier Model CL-600-2B19 series airplanes, that would have required replacement of the existing smoke detectors in the cargo compartment with new, improved smoke detectors. That proposal was prompted by mandatory continuing airworthiness information from a civil airworthiness authority. This new action revises the proposed rule by including spare part information. The actions specified by this new proposed AD are intended to prevent false smoke

warnings from the smoke detectors in the cargo compartment. A false smoke warning prompts the flightcrew to discharge fire extinguisher bottles, leaving those bottles depleted in the event of an actual fire. Repeated false smoke warnings create uncertainty as to whether an emergency landing and emergency evacuation of passengers and flightcrew is warranted.

DATES: Comments must be received by September 10, 2002.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-250-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2001-NM-250-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Bombardier, Inc., Canadair, Aerospace Group, PO Box 6087, Station Centre-ville, Montreal, Quebec H3C 3G9, Canada. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, New York Aircraft Certification Office, 10 Fifth Street, Third Floor, Valley Stream, New York.

FOR FURTHER INFORMATION CONTACT: Dan Parrillo, Aerospace Engineer, ANE-172, FAA, New York Aircraft Certification Office, 10 Fifth Street, Third Floor, Valley Stream, New York; telephone (516) 256-7505; fax (516) 568-2716.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained

in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2001-NM-250-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-250-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

Discussion

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to add an airworthiness directive (AD), applicable to certain Bombardier Model CL-600-2B19 series airplanes was published as a first supplemental notice of proposed rulemaking (NPRM) in the **Federal Register** on April 3, 2002 (67 FR 15760). That action proposed to require replacement of the existing smoke detectors in the cargo compartment with new, improved smoke detectors.

Actions Since Issuance of Previous Proposal

Since the issuance of the first supplemental NPRM, the FAA has determined that, as of the effective date of this AD, no person shall install Walter Kidde Aerospace smoke detectors having part number (P/N) 473052 on any airplane. Therefore, we

have added this requirement to the second supplemental NPRM.

Conclusion

Since this change expands the scope of the first supplemental NPRM, we have determined that it is necessary to reopen the comment period to provide additional opportunity for public comment.

Cost Impact

The FAA estimates that 281 airplanes of U.S. registry would be affected by this AD, that it would take approximately 2 work hours per airplane to accomplish the proposed replacement of the existing smoke detectors in the cargo compartment with new, improved smoke detectors, and that the average labor rate is \$60 per work hour. The cost of required parts is approximately \$4,136 (\$876 for one smoke detector kit and \$1,630 each for two smoke detectors). Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$1,195,936, or \$4,256 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this

action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

Bombardier, Inc. (Formerly Canadair):

Docket 2001-NM-250-AD.

Applicability: Model CL-600-2B19 series airplanes, serial numbers 7003 through 7480 inclusive; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent false smoke warnings from the smoke detectors in the cargo compartment, which prompt the flightcrew to discharge fire extinguisher bottles, leaving those bottles depleted in the event of an actual fire, or which create uncertainty as to whether an emergency landing and emergency evacuation of passengers and flightcrew is warranted, accomplish the following:

Replacement

- (a) Within 18 months after the effective date of this AD: Replace the existing smoke detectors having part number (P/N) 473052, which are located in the cargo compartment, with new, improved smoke detectors having P/N 473597-19, in accordance with Bombardier Service Bulletin 601R-26-016, Revision "B," dated August 10, 2001, or Revision "C," dated August 17, 2001.

Spares

(b) As of the effective date of this AD, no person shall install Walter Kidde Aerospace smoke detectors having P/N 473052 on any airplane.

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, New York Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, New York ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the New York ACO.

Special Flight Permits

(d) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Note 3: The subject of this AD is addressed in Canadian airworthiness directive CF-2001-21, dated May 23, 2001.

Issued in Renton, Washington, on August 9, 2002.

Vi Lipski,

*Manager, Transport Airplane Directorate,
Aircraft Certification Service.*

[FR Doc. 02-20711 Filed 8-15-02; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2002-NM-53-AD]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model DC-9-10, DC-9-20, DC-9-30, DC-9-40, and DC-9-50 Series Airplanes; and Model DC-9-81 (MD-81), DC-9-82 (MD-82), DC-9-83 (MD-83), DC-9-87 (MD-87), and MD-88 Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model DC-9-10, DC-9-20, DC-9-30, DC-9-40, and DC-9-50 series airplanes; and Model DC-9-81 (MD-81), DC-9-82 (MD-82), DC-9-83 (MD-83), DC-9-87 (MD-87), and MD-88 airplanes. This proposal

would require replacement of the emergency power switch knob on the overhead switch panel in the flight compartment with a new, improved knob made of non-conductive material. This action is necessary to prevent the knob from conducting electricity, which could result in delivery of an electrical shock and consequent injury to flightcrew or maintenance personnel. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by September 30, 2002.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2002-NM-53-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2002-NM-53-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California.

FOR FURTHER INFORMATION CONTACT:

Technical Information: Elvin K. Wheeler, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5344; fax (562) 627-5210.

Other Information: Judy Golder, Airworthiness Directive Technical Editor/Writer; telephone (425) 687-4241, fax (425) 227-1232. Questions or comments may also be sent via the Internet using the following address: judy.golder@faa.gov. Questions or comments sent via the Internet as attached electronic files must be

formatted in Microsoft Word 97 for Windows or ASCII text.

SUPPLEMENTARY INFORMATION:**Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2002-NM-53-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2002-NM-53-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

Discussion

The FAA has received a report that a mechanic received an electrical shock during maintenance on the overhead switch panel on a McDonnell Douglas Model DC-9-82 (MD-82) airplane. The mechanic was rotating the emergency power switch when he received the