

# Proposed Rules

Federal Register

Vol. 68, No. 62

Tuesday, April 1, 2003

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2001–NM–280–AD]

RIN 2120–AA64

#### Airworthiness Directives; Aerospatiale Model ATR42 Series Airplanes, and Model ATR72 Series Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Aerospatiale Model ATR42–200, –300, –320, –500 series airplanes, and Model ATR72 series airplanes. This proposal would require replacement of a certain Automatic Takeoff Power Control System (ATPCS) test selector switch with a different test selector switch. This action is necessary to prevent shorting of a contact in the ATPCS test selector switch due to abnormal wear of contact surfaces, which could result in dual engine power drop with associated loss of both alternating current wild and main hydraulic power during ground maneuvers, and consequent reduced controllability of the airplane and increased flight crew workload. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by May 1, 2003.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2001–NM–280–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments

may also be sent via the Internet using the following address: *9-anm-nprmcomment@faa.gov*. Comments sent via fax or the Internet must contain “Docket No. 2001–NM–280–AD” in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Aerospatiale, 316 Route de Bayonne, 31060 Toulouse, Cedex 03, France. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

**FOR FURTHER INFORMATION CONTACT:** Dan Rodina, Aerospace Engineer, International Branch, ANM–116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055–4056; telephone (425) 227–2125; fax (425) 227–1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (*e.g.*, reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report

summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: “Comments to Docket Number 2001–NM–280–AD.” The postcard will be date stamped and returned to the commenter.

#### Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2001–NM–280–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056.

#### Discussion

The Direction Générale de l’Aviation Civile (DGAC), which is the airworthiness authority for France, notified the FAA that an unsafe condition may exist on certain Aerospatiale Model ATR42–200, –300, –320, and –500 series airplanes, and Model ATR72 series airplanes. The DGAC advises that it has received several reports of dual engine power drop during ground maneuvers, with associated loss of both alternating current wild (ACW) and main hydraulic power. Investigation revealed abnormal wear of contact surfaces within the IPP JANCO ATPCS (Automatic Takeoff Power Control System) test selector switch. The abnormal wear is suspected to have caused contact shorting. (Each time the ATPCS test selector switch was replaced, the malfunction cleared.) Due to the different governing modes applicable during these operating phases, the malfunction can only occur during taxiing or landing, not during takeoff or in flight. Shorting of the contact in the ATPCS test selector switch due to abnormal wear of contact surfaces, if not corrected, could result in dual engine power drop with associated loss of both ACW and main hydraulic power during ground maneuvers, and consequent reduced controllability of the airplane and increased flight crew workload.

#### Explanation of Relevant Service Information

Aerospatiale has issued Avions de Transport Regional Service Letters

ATR42-61-5012 (for Model ATR42 series airplanes) and ATR72-61-6008 (for Model ATR72 series airplanes), both dated April 23, 2002, which describe procedures for replacing the IPP JANCO ATPCS test selector switch on panel 114VU (FIN 22KF) with an IEC Electronique test selector switch. Accomplishment of the actions specified in the applicable service letter is intended to adequately address the identified unsafe condition. The DGAC classified these actions as mandatory and issued French airworthiness directives 2001-214-084(B) and 2001-215-057(B), both dated May 30, 2001, in order to assure the continued airworthiness of these airplanes in France.

### FAA's Conclusions

These airplane models are manufactured in France and are type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the DGAC has kept the FAA informed of the situation described above. The FAA has examined the findings of the DGAC, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

### Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design registered in the United States, the proposed AD would require accomplishment of the actions specified in the applicable service letter described previously.

### Cost Impact

The FAA estimates that 133 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 4 work hours per airplane to accomplish the proposed replacement, and that the average labor rate is \$60 per work hour. Required parts would cost approximately \$536 per airplane. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$103,208, or \$776 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if

this proposed AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

### Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption ADDRESSES.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

### The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

**Aerospatiale:** Docket 2001-NM-280-AD.

**Applicability:** Model ATR42-200, -300, -320, -500 series airplanes, and Model ATR72 series airplanes; certificated in any category; equipped with IPP JANCO

Automatic Takeoff Power Control System (ATPCS) test selector switch, part number (P/N) ACE 0002; except those airplanes having received modification 5162 in production and on which no replacement of the ATPCS test selector switch has been performed afterwards.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent shorting of a contact in the ATPCS test selector switch due to abnormal wear of contact surfaces, which could result in dual engine power drop with associated loss of both alternating current wild and main hydraulic power during ground maneuvers, and consequent reduced controllability of the airplane and increased flight crew workload, accomplish the following:

### Replacement

(a) Within 5 years after the effective date of this AD, replace the IPP JANCO Automatic Takeoff Power Control System (ATPCS) test selector switch having P/N ACE 0002 on panel 114VU (FIN 22KF) with an IEC Electronique test selector switch having P/N 097-037-00, per Avions de Transport Regional Service Letters ATR42-61-5012 (for Model ATR42 series airplanes) or ATR72-61-6008 (for Model ATR72 series airplanes), both dated April 23, 2002; as applicable.

### Parts Installation

(b) As of the effective date of this AD, no person shall install an IPP JANCO ATPCS test selector switch, P/N ACE 0002, on any airplane.

### Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

### Special Flight Permits

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199

of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

**Note 3:** The subject of this AD is addressed in French airworthiness directives 2001-214-084(B) and 2001-215-057(B), both dated May 30, 2001.

Issued in Renton, Washington, on March 26, 2003.

**Michael J. Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*  
[FR Doc. 03-7749 Filed 3-31-03; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-NM-33-AD]

RIN 2120-AA64

#### **Airworthiness Directives; Empresa Brasileira de Aeronautica S.A. (EMBRAER) Model EMB-120 Series Airplanes**

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to all Empresa Brasileira de Aeronautica S.A. (EMBRAER) Model EMB-120 series airplanes. This proposal would require revising the airplane flight manual to include operational limitations for use of the autopilot, and installing two placards that advise the flight crew to check the pitch trim before descent. This action is necessary to prevent pitch trim upsets if the pitch trim actuators jam or freeze, which could result in reduced controllability of the airplane. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by May 1, 2003.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2003-NM-33-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: *9-anm-*

*nprcomment@faa.gov*. Comments sent via fax or the Internet must contain "Docket No. 2003-NM-33-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Empresa Brasileira de Aeronautica S.A. (EMBRAER), PO Box 343—CEP 12.225, Sao Jose dos Campos—SP, Brazil. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

**FOR FURTHER INFORMATION CONTACT:** Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2125; fax (425) 227-1149.

#### **SUPPLEMENTARY INFORMATION:**

##### **Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (*e.g.*, reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action

must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2003-NM-33-AD." The postcard will be date stamped and returned to the commenter.

#### **Availability of NPRMs**

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2003-NM-33-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

#### **Discussion**

The Departamento de Aviacao Civil (DAC), which is the airworthiness authority for Brazil, notified the FAA that an unsafe condition may exist on all Empresa Brasileira de Aeronautica S.A. (EMBRAER) Model EMB-120 series airplanes. The DAC advises that several events involving pitch trim upsets have occurred on these airplanes during the autopilot coupled descent phase of flight. The pitch trim upsets have been attributed to jammed or frozen pitch trim actuators. As the airplane ascends through visible moisture, the pitch trim actuators can freeze in a position trimmed for cruise flight. During a coupled descent, the autopilot will attempt to retrim the airplane, and, if the actuators are frozen, the control cables in the pitch trim system can become stretched. If the autopilot is subsequently disengaged for any reason, the spring-back effect caused by the sudden release of the tension in the stretched cables could result in a pitch upset. This condition, if not corrected, could result in reduced controllability of the airplane.

#### **Airplane Flight Manual (AFM) Revisions**

The DAC advises that the flight crew must check the pitch trim before any descent. The check will alert the crew to a possible frozen or jammed actuator and enable the crew to take appropriate action to prevent a pitch upset. The check procedures are described in certain AFM revisions, which the DAC has mandated.

#### **Explanation of Relevant Service Information**

The manufacturer has issued EMBRAER Service Bulletin 120-25-0262, dated October 15, 2001; and Change 01, dated September 3, 2002. The service bulletins describe procedures for installing two placards that advise the flight crew to check the pitch trim before descent. The DAC classified these service bulletins as mandatory and issued Brazilian