

Proposed Rules

Federal Register

Vol. 69, No. 63

Thursday, April 1, 2004

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2002–NM–319–AD]

RIN 2120–AA64

Airworthiness Directives; Saab Model SAAB SF340A Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Saab Model SAAB SF340A series airplanes. This proposal would require replacing certain power wires with a modification harness; and testing the new harness installation. These actions are necessary to prevent a momentary loss of data on the left-hand electronic flight instrumentation system (LH EFIS) screens, which could lead to the pilot's loss of situational awareness during initial climb or approach/landing, and possibly result in reduced control of the airplane. These actions are intended to address the identified unsafe condition.

DATES: Comments must be received by May 3, 2004.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2002–NM–319–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain “Docket No. 2002–NM–319–AD” in the subject line and need not be submitted

in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 or 2000 or ASCII text.

The service information referenced in the proposed rule may be obtained from Saab Aircraft AB, SAAB Aircraft Product Support, S–581.88, Linköping, Sweden. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

FOR FURTHER INFORMATION CONTACT:

Rosanne Ryburn, Aerospace Engineer, International Branch, ANM–116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055–4056; telephone (425) 227–2139; fax (425) 227–1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (*e.g.*, reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments

submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: “Comments to Docket Number 2002–NM–319–AD.” The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2002–NM–319–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056.

Discussion

The Luftfartsverket (LFV), which is the airworthiness authority for Sweden, notified the FAA that an unsafe condition may exist on certain Saab Model SAAB SF340A series airplanes. The LFV advises that a momentary power bus voltage drop caused by a high inrush current to the hydraulic pump occurs when the pump starts to supply hydraulic power to the landing gear and/or flaps. This voltage drop could cause a momentary loss of data on the left-hand electronic flight instrumentation system (LH EFIS) screens. This condition, if not corrected, could lead to the pilot's loss of situational awareness during initial climb or approach/landing, and possibly result in reduced control of the airplane.

Explanation of Relevant Service Information

Saab has issued Service Bulletin 340–29–021, Revision 02, dated October 2, 2002, which describes procedures for replacing certain power wires with a modification harness; and testing the new harness installation. Accomplishment of the actions specified in the service bulletin is intended to adequately address the identified unsafe condition. The LFV classified this service bulletin as mandatory and issued Swedish airworthiness directive 1–179, dated October 2, 2002, to ensure the continued airworthiness of these airplanes in Sweden.

FAA's Conclusions

This airplane model is manufactured in Sweden and is type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral

airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the LfV has kept the FAA informed of the situation described above. The FAA has examined the findings of the LfV, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design registered in the United States, the proposed AD would require accomplishment of the actions specified in the service bulletin described previously.

Cost Impact

The FAA estimates that 12 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 30 work hours per airplane to accomplish the proposed actions, and that the average labor rate is \$65 per work hour. Required parts would cost approximately \$5,500 per airplane. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$89,400, or \$7,450 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44

FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption ADDRESSES.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

SAAB Aircraft AB: Docket 2002–NM–319–AD.

Applicability: Model SAAB SF340A series airplanes, manufacturer serial number –004 through –028 inclusive; certificated in any category.

Compliance: Required as indicated, unless accomplished previously.

To prevent a momentary loss of data on the left-hand electronic flight instrumentation system (LH EFIS) screens, which could lead to the pilot's loss of situational awareness during initial climb or approach/landing, and possibly result in reduced control of the airplane, accomplish the following:

Replacement and Test

(a) Within 12 months after the effective date of this AD, replace certain power wires with a modification harness, and test the harness installation; by doing all of the actions in, and in accordance with, the Accomplishment Instructions of Saab Service Bulletin 340–29–021, Revision 02, dated October 2, 2002.

Alternative Methods of Compliance

(b) In accordance with 14 CFR 39.19, the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, is authorized to approve alternative methods of compliance for this AD.

Note 1: The subject of this AD is addressed in Swedish airworthiness directive 1–179, dated October 2, 2002.

Issued in Renton, Washington, on March 25, 2004.

Kevin M. Mullin,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 04–7291 Filed 3–31–04; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2003–NM–126–AD]

RIN 2120–AA64

Airworthiness Directives; Boeing Model 747–400 and –400D Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Boeing Model 747–400 and –400D series airplanes. This proposal would require an inspection to detect missing fasteners in the section 42 skin and internal doubler at the cutout for the ground exhaust valve of the electrical equipment; modification and rework of the doubler; repetitive inspections of the skin for cracks; and corrective actions if necessary; as applicable. This action is necessary to detect and correct fatigue cracks in the section 42 skin at the cutout for the ground exhaust valve of the electrical equipment, which could result in rapid decompression of the airplane. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by May 17, 2004.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2003–NM–126–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2003–NM–126–AD" in the subject line and need not be submitted in triplicate. Comments sent via the