

the FAA proposes to amend 14 CFR part 39 as follows:

## **PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### **§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA–2014–0489; Directorate Identifier 2014–NM–048–AD.

#### **(a) Comments Due Date**

We must receive comments by September 18, 2014.

#### **(b) Affected ADs**

None.

#### **(c) Applicability**

This AD applies to Bombardier, Inc. Model CL–600–2B19 (Regional Jet Series 100 & 440) airplanes, certificated in any category, serial numbers 7003 and subsequent.

#### **(d) Subject**

Air Transport Association (ATA) of America Code 32, Landing Gear.

#### **(e) Reason**

This AD was prompted by a report indicating that inboard and outboard hydraulic lines of the brakes were found connected to the incorrect ports on the swivel assembly of the main landing gear (MLG). We are issuing this AD to prevent incorrect installation of the brake hydraulic lines, which could cause the brakes and the anti-skid system to operate incorrectly, and cause catastrophic failure of the airplane during a high-speed rejected take-off.

#### **(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

#### **(g) Modification**

Within 6,600 flight hours after the effective date of this AD, but no later than 36 months after the effective date of this AD: Modify the MLG by installing a new bracket on the left and right lower aft-wing planks, in accordance with the Accomplishment Instruction of Bombardier Service Bulletin 601R–32–110, dated December 19, 2013.

#### **(h) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information

directly to the New York ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516 228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE–170, Engine and Propeller Directorate, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

#### **(i) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF–2014–10, dated February 12, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0489.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on July 18, 2014.

**John P. Piccola,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014–18367 Filed 8–1–14; 8:45 am]

**BILLING CODE 4910–13–P**

## **DEPARTMENT OF TRANSPORTATION**

### **Federal Aviation Administration**

#### **14 CFR Part 39**

**[Docket No. FAA–2014–0492; Directorate Identifier 2013–NM–134–AD]**

**RIN 2120–AA64**

### **Airworthiness Directives; Fokker Services B.V. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all

Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. This proposed AD was prompted by a report of two cases of heavy (hard to move) aileron control caused by aileron cables stuck in a clump of ice in the wheel bay. This proposed AD would require installing drain tubes on the center wing rear spar. We are proposing this AD to prevent accumulated water near or on the aileron control cables, which could freeze and result in reduced control of the airplane.

**DATES:** We must receive comments on this proposed AD by September 18, 2014.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88–6280–350; fax +31 (0)88–6280–111; email [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

#### **Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0492; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2014-0492; Directorate Identifier 2013-NM-134-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2013-0140, dated July 12, 2013 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. The MCAI states:

Two cases have been reported of heavy aileron control caused by aileron cables stuck in a clump of ice in the wheel bay. Investigation results revealed that, in case of water accumulation on the top of the center wing torsion box inside the cabin (zones 171 and 172), the water drains through the existing drain holes/gaps in the web plates on top of the center wing rear spar. The water could then accumulate in the area where the aileron control cables are situated. With the freezing temperatures normally encountered during flight, ice accretion could occur near or even on the aileron control cables.

This condition, if not corrected, could result in reduced control of the aeroplane.

For the reasons described above, this [EASA] AD requires the installation of drain tubes on the center wing rear spar.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0492.

**Relevant Service Information**

Fokker Services B.V. has issued Fokker Service Bulletin SBF100-51-021, dated April 23, 2013, including the following attachments:

- Fokker Parts List Local SB10051021-XU-B, Revision A, Sequence 1, dated April 4, 2013;
  - Fokker Parts List Supply SB10051021-XU-B, Revision A, Sequence 1, dated April 10, 2013;
  - Fokker Parts List Local SB10051021-XU-A, Revision B, Sequence 1, dated April 10, 2013;
  - Fokker Parts List Supply SB10051021-XU-A, Revision B, Sequence 1, dated April 10, 2013; and
  - Fokker Manual Change Notification MCNM F100-160, dated April 23, 2013.
- The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

**“Contacting the Manufacturer” Paragraph in This Proposed AD**

Since late 2006, we have included a standard paragraph titled “Airworthy Product” in all MCAI ADs in which the FAA develops an AD based on a foreign authority’s AD.

The MCAI or referenced service information in an FAA AD often directs the owner/operator to contact the manufacturer for corrective actions, such as a repair. Briefly, the Airworthy Product paragraph allowed owners/operators to use corrective actions provided by the manufacturer if those actions were FAA-approved. In addition, the paragraph stated that any actions approved by the State of Design Authority (or its delegated agent) are considered to be FAA-approved.

In an NPRM having Directorate Identifier 2012-NM-101-AD (78 FR 78285, December 26, 2013), we proposed to prevent the use of repairs that were not specifically developed to correct the unsafe condition, by requiring that the repair approval

provided by the State of Design Authority or its delegated agent specifically refer to the FAA AD. This change was intended to clarify the method of compliance and to provide operators with better visibility of repairs that are specifically developed and approved to correct the unsafe condition. In addition, we proposed to change the phrase “its delegated agent” to include a design approval holder (DAH) with State of Design Authority design organization approval (DOA), as applicable, to refer to a DAH authorized to approve required repairs for the proposed AD.

One commenter to the NPRM having Directorate Identifier 2012-NM-101-AD (78 FR 78285, December 26, 2013) stated the following: “The proposed wording, being specific to repairs, eliminates the interpretation that Airbus messages are acceptable for approving minor deviations (corrective actions) needed during accomplishment of an AD mandated Airbus service bulletin.”

This comment has made the FAA aware that some operators have misunderstood or misinterpreted the Airworthy Product paragraph to allow the owner/operator to use messages provided by the manufacturer as approval of deviations during the accomplishment of an AD-mandated action. The Airworthy Product paragraph does not approve messages or other information provided by the manufacturer for deviations to the requirements of the AD-mandated actions. The Airworthy Product paragraph only addresses the requirement to contact the manufacturer for corrective actions for the identified unsafe condition and does not cover deviations from other AD requirements. However, deviations to AD-required actions are addressed in 14 CFR 39.17, and anyone may request the approval for an alternative method of compliance to the AD-required actions using the procedures found in 14 CFR 39.19.

To address this misunderstanding and misinterpretation of the Airworthy Product paragraph, we have changed the paragraph and retitled it “Contacting the Manufacturer.” This paragraph now clarifies that for any requirement in this proposed AD to obtain corrective actions from a manufacturer, the actions must be accomplished using a method approved by the FAA, EASA, or Fokker B.V. Service’s EASA DOA.

The Contacting the Manufacturer paragraph also clarifies that, if approved by the DOA, the approval must include the DOA-authorized signature. The DOA signature indicates that the data and information contained in the document are EASA-approved, which is also FAA-

approved. Messages and other information provided by the manufacturer that do not contain the DOA-authorized signature approval are not EASA-approved, unless EASA directly approves the manufacturer's message or other information.

This clarification does not remove flexibility previously afforded by the Airworthy Product paragraph. Consistent with long-standing FAA policy, such flexibility was never intended for required actions. This is also consistent with the recommendation of the Airworthiness Directive Implementation Aviation Rulemaking Committee to increase flexibility in complying with ADs by identifying those actions in manufacturers' service instructions that are "Required for Compliance" with ADs. We continue to work with manufacturers to implement this recommendation. But once we determine that an action is required, any deviation from the requirement must be approved as an alternative method of compliance.

#### Costs of Compliance

We estimate that this proposed AD affects 4 airplanes of U.S. registry.

We also estimate that it would take about 8 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$1,380 per product. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$8,240, or \$2,060 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This proposed regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Fokker Services B.V.:** Docket No. FAA–2014–0492; Directorate Identifier 2013–NM–134–AD.

##### (a) Comments Due Date

We must receive comments by September 18, 2014.

##### (b) Affected ADs

None.

##### (c) Applicability

This AD applies to Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes, certificated in any category, all serial numbers.

##### (d) Subject

Air Transport Association (ATA) of America Code 51, Standard Practices/Structures.

#### (e) Reason

This AD was prompted by a report of two cases of heavy (difficult to move) aileron control caused by aileron cables stuck in a clump of ice in the wheel bay. We are issuing this AD to prevent accumulated water near or on the aileron control cables, which could freeze and result in reduced control of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Installation of Water Drain Tubes

Within 36 months after the effective date of this AD, install water drain tubes on the center wing rear spar, in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100–51–021, dated April 23, 2013, including the attachments identified in paragraphs (g)(1) through (g)(5) of this AD.

(1) Fokker Parts List Local SB10051021–XU–B, Revision A, Sequence 1, dated April 4, 2013.

(2) Fokker Parts List Supply SB10051021–XU–B, Revision A, Sequence 1, dated April 10, 2013.

(3) Fokker Parts List Local SB10051021–XU–A, Revision B, Sequence 1, dated April 10, 2013.

(4) Fokker Parts List Supply SB10051021–XU–A, Revision B, Sequence 1, dated April 10, 2013.

(5) Fokker Manual Change Notification MCNM F100–160, dated April 23, 2013.

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1137; fax 425–227–1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Fokker Services B.V.'s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

**(i) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency Airworthiness Directive 2013–0140, dated July 12, 2013, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0492.

(2) For service information identified in this AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88–6280–350; fax +31 (0)88–6280–111; email [technicalservices@fokker.com](mailto:technicalservices@fokker.com); Internet <http://www.myfokkerfleet.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on July 23, 2014.

**John P. Piccola,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014–18373 Filed 8–1–14; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2014–0491; Directorate Identifier 2014–NM–023–AD]

**RIN 2120–AA64**

**Airworthiness Directives; Bombardier, Inc. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model CL–600–1A11 (CL–600), CL–600–2A12 (CL–601), and CL–600–2B16 (CL–601–3A, CL–601–3R, and CL–604 Variants) airplanes. This proposed AD was prompted by a determination that the forward lugs of the flap hinge box might not conform to engineering drawings, which could result in premature fatigue cracking. This proposed AD would require revising the maintenance or inspection program to include new airworthiness limitations tasks; and measuring the forward lug edge distance of each flap hinge box, and inspecting for cracking and damage (i.e., deformation or bearing failure) of the forward lug edge of each flap hinge box, and repair if necessary. We are proposing this AD to detect and correct non-conforming flap hinge box

forward lugs, which could result in failure of the lugs and detachment of the flap hinge box and consequent detachment of the flap surface.

**DATES:** We must receive comments on this proposed AD by September 18, 2014.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202–493–2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0491; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Ricardo Garcia, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE–171, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7331; fax 516–794–5531.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2014–0491; Directorate Identifier 2014–NM–023–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF–2014–01, dated January 3, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

The aeroplane manufacturer has determined that the flap hinge box forward lugs edge distance may not conform to the engineering drawings. Non-conforming flap hinge box forward lugs may result in premature fatigue cracking.

Failure of the lugs could lead to the detachment of the flap hinge box and consequently the detachment of the flap surface. The loss of a flap surface could adversely affect the continued safe operation of the aeroplane.

This [Canadian] AD mandates the incorporation of new Time Limits/Maintenance Checks (TLMC) Airworthiness Limitations (AWL) tasks, and the measurement [and inspection for cracking and damage] of the forward lug edge distance of each flap hinge-box and rectification as required.

Corrective actions include repairing damage and cracking. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–0491.

**Relevant Service Information**

Bombardier has issued the following service information. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

- Bombardier Service Bulletin 600–0762, dated September 26, 2013 (for Model CL–600–1A11 airplanes).