

# Proposed Rules

Federal Register

Vol. 79, No. 22

Monday, February 3, 2014

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2014-0005; Directorate Identifier 2013-NM-144-AD]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A310 series airplanes. This proposed AD was prompted by a report of an electrical arc and a hydraulic haze in the wheel bay of the left-hand main landing gear (MLG), possibly resulting from chafing between a hydraulic high pressure hose and electrical wiring of the green electrical motor pump (EMP). This proposed AD would require modification of the electrical routing and replacement of the union elbows. We are proposing this AD to prevent chafing of hydraulic pressure hoses and electrical wiring of the green EMPs, which, in combination with a system failure, could cause an uncontrolled and undetected fire in the MLG bay.

**DATES:** We must receive comments on this proposed AD by March 20, 2014.

**ADDRESSES:** You may send comments by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** (202) 493-2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

• **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0005; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-2125; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2014-0005; Directorate Identifier 2013-NM-144-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each

substantive verbal contact we receive about this proposed AD.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2013-0165, dated July 25, 2013 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

An A310 operator reported an electrical arc and a large hydraulic haze in the Left Hand (LH) Main Landing Gear (MLG) wheel bay that occurred during ground operation.

The analysis of the occurrence revealed that this was likely caused by chafing between a hydraulic high pressure hose and electrical wiring of the Green Electrical Motor Pump (EMP).

This condition, \* \* \* could result in an undetected and uncontrolled fire in the LH MLG wheel bay.

For the reason described above, this [EASA] AD requires modification of the electrical routing and installation of reinforced hydraulic pipes [by replacing the union elbows to re-route the delivery pipe at the upper EMP].

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA-2014-0005.

#### Relevant Service Information

Airbus has issued Mandatory Service Bulletin A310-29-2103, dated December 21, 2012. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

## Costs of Compliance

We estimate that this proposed AD affects 36 airplanes of U.S. registry.

We also estimate that it would take about 4 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$1,170 per product. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be 54,360, or \$1,510 per product.

## Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This proposed regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

## Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**Airbus:** Docket No. FAA-2014-0005; Directorate Identifier 2013-NM-144-AD.

#### (a) Comments Due Date

We must receive comments by March 20, 2014.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus Model A310-203, -204, -221, -222, -304, -322, -324, and -325 airplanes, certificated in any category, all serial numbers on which Airbus modification number 04797 has been embodied in production and those on which Airbus Service Bulletin A310-29-2091 has been embodied in service.

#### (d) Subject

Air Transport Association (ATA) of America Code 29, Hydraulic Power.

#### (e) Reason

This AD was prompted by a report of an electrical arc and a hydraulic haze in the wheel bay of the left-hand main landing gear (MLG) possibly resulting from chafing between a hydraulic high pressure hose and electrical wiring of the green electrical motor pump (EMP). We are issuing this AD to prevent chafing of hydraulic pressure hoses and electrical wiring of the green EMPs, which, in combination with a system failure, could cause an uncontrolled and undetected fire in the MLG bay.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Actions

Within 36 months after the effective date of this AD, modify the electrical routing of the electrical motor pump (EMP) power supply in the hydraulic bay at frame 54 on the left-hand side and replace the union elbows to re-route the delivery pipe at the upper EMP, in accordance with the Accomplishment Instructions of Airbus Mandatory Service Bulletin A310-29-2103, dated December 21, 2012.

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-2125; fax (425) 227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they were approved by the State of Design Authority (or its delegated agent, or the DAH with a State of Design Authority's design organization approval). For a repair method to be approved, the repair approval must specifically refer to this AD. You are required to ensure the product is airworthy before it is returned to service.

#### (i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency Airworthiness Directive 2013-0165, dated July 25, 2013, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating it in Docket No. FAA-2014-0005.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on January 22, 2014.

**Jeffrey E. Duven,**

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014-02158 Filed 1-31-14; 8:45 am]

**BILLING CODE 4910-13-P**