

Issued in Washington, DC, on October 20, 2014.

Kathleen B. Hogan,

Deputy Assistant Secretary for Energy Efficiency, Energy Efficiency and Renewable Energy.

[FR Doc. 2014-25277 Filed 10-22-14; 8:45 am]

BILLING CODE 6450-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2014-0848; Directorate Identifier 2014-CE-031-AD]

RIN 2120-AA64

Airworthiness Directives; Grob-Werke Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Grob-Werke Models G115EG and G120A airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as a defective starter solenoid. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by December 8, 2014.

ADDRESSES: You may send comments by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: (202) 493-2251.
- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- Hand Delivery: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Grob Aircraft AG, Customer Service, Lettenbachstrasse 9, D-86874 Tussenhausen-Mattsies, Germany, telephone: + 49 (0) 8268-998-105; fax:

+ 49 (0) 8268-998-200; email: productsupport@grob-aircraft.com; Internet: grob-aircraft.com. You may review this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0848; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4123; fax: (816) 329-4090; email: karl.schletzbaum@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2014-0848; Directorate Identifier 2014-CE-031-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued AD No. 2014-0212, dated September 19, 2014 (referred to after this as "the MCAI"), to correct an unsafe condition for certain

Grob-Werke Models G115EG and G120A airplanes. The MCAI states:

An operator of a G 115E aeroplane experienced a total loss of electrical power in flight. The root cause was found to be a defective starter solenoid causing an internal short circuit, which resulted in breakdown of the system voltage.

This condition, if not detected and corrected, could result in reduced control of the aeroplane.

To address this potential unsafe condition, GROB Aircraft AG issued Service Bulletin (SB) MSB1078-196 for G 115 aeroplanes and SB MSB1121-144 for G 120 aeroplanes to provide instructions for inspection and corrective action.

For the reason described above, this AD requires a one-time inspection of the starter solenoid and, depending on the findings, replacement of the starter.

A technical solution is currently under development and further AD action may follow.

You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0848.

Relevant Service Information

GROB Aircraft has issued Service Bulletin No. MSB1078-196 and Service Bulletin No. MSB1121-144, both dated July 14, 2014. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

Interim Action

We consider this proposed AD interim action. GROB Aircraft is currently working on a final technical solution to resolve the unsafe condition. If final action is later identified, we might consider further rulemaking.

Costs of Compliance

We estimate that this proposed AD will affect 6 products of U.S. registry. We also estimate that it would take about 4 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$2,040, or \$340 per product.

In addition, we estimate that any necessary follow-on actions would take about 4 work-hours and require parts costing \$600, for a cost of \$940 per product. We have no way of determining the number of products that may need these actions.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. Amend § 39.13 by adding the following new AD:

Grob-Werke: Docket No. FAA-2014-0848; Directorate Identifier 2014-CE-031-AD.

(a) Comments Due Date

We must receive comments by December 8, 2014.

(b) Affected ADs

None.

(c) Applicability

This AD applies to GROB-WERKE Model G115EG airplanes, all serial numbers through 82323/E, and Model G120A airplanes, all serial numbers through 85063, certificated in any category.

(d) Subject

Air Transport Association of America (ATA) Code 80: Starting.

(e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as a defective starter solenoid. We are issuing this AD to detect and correct defective starter solenoids, which could cause an internal short circuit and could result in reduced control.

(f) Actions and Compliance

Unless already done, do the actions in paragraphs (f)(1) and (f)(2) of this AD:

(1) Within the next 30 days after the effective date of this AD, inspect the starter following the Accomplishment Instructions in GROB Aircraft Service Bulletin No. MSB1078-196, dated July 14, 2014, or GROB Aircraft Service Bulletin No. MSB1121-144, dated July 14, 2014, as applicable.

(2) If any damage is found on the starter during the inspection required in paragraph (f)(1) of this AD, before further flight, replace the starter with a serviceable part. Do the replacement following the Accomplishment Instructions in GROB Aircraft Service Bulletin No. MSB1078-196, dated July 14, 2014, or GROB Aircraft Service Bulletin No. MSB1121-144, dated July 14, 2014, as applicable.

(g) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office,

FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4123; fax: (816) 329-4090; email: karl.schletzbaum@faa.gov. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(h) Related Information

Refer to MCAI European Aviation Safety Agency (EASA) AD No. 2014-0212, dated September 19, 2014, for related information. You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0848. For service information related to this AD, contact Grob Aircraft AG, Customer Service, Lettenbachstrasse 9, D-86874 Tussenhausen-Mattsies, Germany, telephone: + 49 (0) 8268-998-105; fax: + 49 (0) 8268-998-200; email: productsupport@grob-aircraft.com; Internet: grob-aircraft.com. You may review this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued in Kansas City, Missouri, on October 16, 2014.

Earl Lawrence,

Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014-25226 Filed 10-22-14; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2014-0754; Directorate Identifier 2014-NM-136-AD]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model DHC-8-400 series airplanes. This proposed AD was