

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved for AD 2006–10–16, Amendment 39–14600 (71 FR 28570, May 17, 2006), are approved as AMOCs for the corresponding provisions of paragraph (g) of this AD, except for approved AMOCs that allow installation of Maraging or H–11 steel fasteners.

#### (m) Related Information

(1) For more information about this AD, contact Nathan Weigand, Aerospace Engineer, Airframe Branch, ANM–120S, FAA, Seattle ACO, 1601 Lind Avenue SW., Renton, WA 98057–3356; phone: 425–917–6428; fax: 425–917–6590; email: [nathan.p.weigand@faa.gov](mailto:nathan.p.weigand@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H–65, Seattle, WA 98124–2207; telephone: 206–544–5000, extension 1; fax: 206–766–5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on November 19, 2015.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015–30120 Filed 11–25–15; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2015–5813; Directorate Identifier 2014–NM–111–AD]

**RIN 2120–AA64**

#### Airworthiness Directives; Dassault Aviation Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Dassault Aviation Model FALCON 7X airplanes. This proposed AD was prompted by a fuel leak that occurred in the baggage compartment during fuel system pressurization. This proposed AD would require opening the fuel

boxes and restoring the sealing. We are proposing this AD to detect and correct failure of a connector or coupling on a fuel line, which, in combination with a leak in the corresponding enclosure (*i.e.*, fuel box), could result in a fire in the baggage compartment and affect the safe flight of the airplane.

**DATES:** We must receive comments on this proposed AD by January 11, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: 202–493–2251.
- Mail: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- Hand Delivery: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Dassault Falcon Jet, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201–440–6700; Internet <http://www.dassaultfalcon.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–5813; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone (425) 227–1137; fax (425) 227–1149.

**SUPPLEMENTARY INFORMATION:**

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2015–5813; Directorate Identifier 2014–NM–111–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2014–0116, dated May 13, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Dassault Aviation Model FALCON 7X airplanes. The MCAI states:

During the fuel system pressurization of a production line Falcon 7X aeroplane, a fuel leak occurred in the baggage compartment. The technical investigations concluded that a double failure of a connector (or coupling) on a fuel line, in combination with a defective fuel tightness of the corresponding enclosure (fuel box), caused the leak.

Failure of the second barrier (fuel box) is a dormant failure, as this will only manifest itself in case of connector (or fuel pipe coupling) failure in flight.

This condition, if not corrected, could result in a fire in the baggage compartment, which would affect the aeroplane safe flight.

To address this potential unsafe condition, Dassault Aviation issued Service Bulletin (SB) F7X–284, which provides instructions to restore the sealing of the Left Hand (LH) and Right Hand (RH) fuel boxes.

For the reasons described above, this [EASA] AD requires opening of the fuel boxes and restoration of the sealing of the fuel boxes to meet the initial design specifications.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–5813.

#### Related Service Information Under 14 CFR Part 51

Dassault Aviation has issued Service Bulletin 7X–284, Revision 1, dated

April 8, 2014. The service information describes procedures for opening the fuel boxes and restoring the sealing. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of this NPRM.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

We estimate that this proposed AD affects 39 airplanes of U.S. registry.

We also estimate that it would take about 16 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts are negligible. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$53,040, or \$1,360 per product.

According to the manufacturer, all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition

that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Dassault Aviation:** Docket No. FAA-2015-5813; Directorate Identifier 2014-NM-111-AD.

#### (a) Comments Due Date

We must receive comments by January 11, 2016.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Dassault Aviation Model FALCON 7X airplanes, certificated in any category, serial numbers (S/Ns) 1 through 140 inclusive, S/Ns 142 through 156 inclusive, S/Ns 158 through 176 inclusive, S/Ns 178 through 181 inclusive, and S/N 183, 184, 187, 188, 190, 194, and 200.

#### (d) Subject

Air Transport Association (ATA) of America Code 28, Fuel.

#### (e) Reason

This AD was prompted by a fuel leak that occurred in the baggage compartment during fuel system pressurization. We are issuing this AD to prevent failure of a connector or coupling on a fuel line, which, in combination with a leak in the corresponding enclosure (*i.e.*, fuel box), could result in a fire in the baggage compartment and affect the safe flight of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Open the Fuel Box and Restore the Sealing

Within 98 months after the effective date of this AD, open the left-hand and right-hand fuel boxes and restore the sealing, in accordance with the Accomplishment Instructions of Dassault Service Bulletin 7X-284, Revision 1, dated April 8, 2014.

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-1137; fax (425) 227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2014-0116, dated May 13, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by

searching for and locating Docket No. FAA–2015–5813.

(2) For service information identified in this AD, contact Dassault Falcon Jet, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201–440–6700; Internet <http://www.dassaultfalcon.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on November 17, 2015.

**Jeffrey E. Duven,**

Manager, Transport Airplane Directorate,  
Airplane Certification Service.

[FR Doc. 2015–30022 Filed 11–25–15; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2015–5811; Directorate Identifier 2014–NM–158–AD]

**RIN 2120–AA64**

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation  
Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking  
(NPRM).

**SUMMARY:** We propose to supersede Airworthiness Directive (AD) 2004–19–11 for certain Airbus Model 320 series airplanes. AD 2004–19–11 currently requires modification of the inner rear spar web of the wing, cold expansion of the attachment holes of the forward pintle fitting and the actuating cylinder anchorage of the main landing gear (MLG), repetitive ultrasonic inspections for cracking of the rear spar of the wing, and corrective action if necessary. AD 2004–19–11 also provides optional terminating action for the repetitive inspections. Since we issued AD 2004–19–11, we have determined that the terminating action is necessary to address the unsafe condition. This proposed AD is intended to complete certain mandated programs intended to support the airplane reaching its limit of validity (LOV) of the engineering data that support the established structural maintenance program. This proposed AD would retain the requirements of AD 2004–19–11 and would require the previously optional terminating action. We are proposing this AD to prevent fatigue cracking of the inner rear spar, which may lead to reduced structural integrity of the wing and the MLG.

**DATES:** We must receive comments on this proposed AD by January 11, 2016.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

#### *Examining the AD Docket*

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–5811; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### **FOR FURTHER INFORMATION CONTACT:**

Sanjay Ralhan, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1405; fax 425–227–1149.

#### **SUPPLEMENTARY INFORMATION:**

##### **Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2015–5811; Directorate Identifier

2014–NM–158–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### **Discussion**

On September 21, 2004, we issued AD 2004–19–11, Amendment 39–13805 (69 FR 58828, October 1, 2004). AD 2004–19–11 requires actions intended to address an unsafe condition on certain Airbus Model 320 series airplanes. AD 2004–19–11 superseded AD 2000–10–15, Amendment 39–17739 (65 FR 34069, May 26, 2000).

Since we issued AD 2004–19–11, Amendment 39–13805 (69 FR 58828, October 1, 2004), we have determined that the modification of the inner rear spar that is an optional terminating action of AD 2004–19–11 must be accomplished in order to address the identified unsafe condition.

As described in FAA Advisory Circular 120–104 ([http://www.faa.gov/documentLibrary/media/Advisory\\_Circular/120-104.pdf](http://www.faa.gov/documentLibrary/media/Advisory_Circular/120-104.pdf)), several programs have been developed to support initiatives that will ensure the continued airworthiness of aging airplane structure. The last element of those initiatives is the requirement to establish a limit of validity (LOV) of the engineering data that support the structural maintenance program under 14 CFR 26.21. This proposed AD is the result of an assessment of the previously established programs by the design approval holder (DAH). The actions specified in this proposed AD are necessary to complete certain programs to ensure the continued airworthiness of aging airplane structure and to support an airplane reaching its LOV.

The European Aviation Safety Agency, which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2014–0169, corrected July 22, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition on certain Airbus Model A320 series airplanes. The MCAI states:

During centre fuselage certification full scale fatigue test, cracks were found on the