

**(d) Subject**

Air Transport Association (ATA) of America Code 53; Fuselage.

**(e) Unsafe Condition**

This AD was prompted by a report of fatigue cracking found in a certain fuselage frame common to the water tank support intercostal clip located between certain stringers. We are issuing this AD to detect and correct cracking, which could grow in size and result in a severed frame. Multiple adjacent severed frames would result in reduced structural integrity of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspection**

Before the accumulation of 34,000 total flight cycles or within 6,000 flight cycles after the effective date of this AD, whichever occurs later, do a high frequency eddy current (HFEC) inspection for any cracking in the fuselage frame at station (STA) 947.5 common to the water tank support intercostal clip located between stringer S-24R and S-25R, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1357, dated August 9, 2016.

(1) If no cracking is found, repeat the inspection thereafter at intervals not to exceed 12,000 flight cycles.

(2) If any cracking is found: Before further flight, repair in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1357, dated August 9, 2016.

**(h) Terminating Action**

Accomplishing the repair in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1357, dated August 9, 2016, terminates the inspection requirements of paragraph (g) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: [9-ANM-LAACO-AMOC-Requests@faa.gov](mailto:9-ANM-LAACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles

ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(j) Related Information**

(1) For more information about this AD, contact Galib Abumeri, Aerospace Engineer, Airframe Branch, ANM-120L, FAA, Los Angeles ACO, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5324; fax: 562-627-5210; email: [galib.abumeri@faa.gov](mailto:galib.abumeri@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on March 14, 2017.

Dionne Palermo,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2017-05519 Filed 3-22-17; 8:45 am]

BILLING CODE 4910-13-P

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2016-9387; Directorate Identifier 2016-NM-182-AD]

RIN 2120-AA64

**Airworthiness Directives; Bombardier, Inc. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model BD-100-1A10 airplanes. This proposed AD was prompted by a report that the equipment racks were not designed to support the weight of all the equipment and the secondary direct current power centers. This proposed AD would require modifying the equipment racks. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by May 8, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone: 514-855-5000; fax: 514-855-7401; email: [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9387; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Aziz Ahmed, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY

11590; telephone: 516-228-7329; fax: 516-794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-9387; Directorate Identifier 2016-NM-182-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

##### Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2016-26, dated September 14, 2016 (referred to after this as the Mandatory Continuing

Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc. Model BD-100-1A10 airplanes. The MCAI states:

During a recent design review, a Bombardier equipment supplier discovered that the weight of the Secondary Direct Current (DC) Power Center was incorrectly reported to the structural partner(s) via their equipment interface drawing. Consequently, the left-hand side (LHS) and right-hand side (RHS) equipment racks were not designed to support the actual weight of all the equipment and the Secondary DC Power Centers under all loading conditions. In the event of a high energy emergency landing or runway excursion, the structural failure of the LHS or RHS equipment racks may result in the blockage of the emergency escape route for the pilot(s) and crew if this condition is not corrected.

Required actions include modifying the equipment racks. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9387.

##### Related Service Information Under 14 CFR Part 51

We reviewed Bombardier Service Bulletin 100-25-39, dated October 26, 2015; and Bombardier Service Bulletin 350-25-002, dated October 26, 2015. This service information describes

procedures for modifying the equipment racks. These documents are distinct since they apply to airplanes having different serial numbers. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

##### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

##### Costs of Compliance

We estimate that this proposed AD affects 161 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

#### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Modify equipment racks ....	Up to 10 work-hours × \$85 per hour = \$850 .....	\$1,755	Up to \$2,605 ..	Up to \$419,405.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

##### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures

the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

##### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

##### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

##### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA–2016–9387; Directorate Identifier 2016–NM–182–AD.

**(a) Comments Due Date**

We must receive comments by May 8, 2017.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Bombardier, Inc. Model BD–100–1A10 airplanes, certificated in any category, serial numbers (S/Ns) 20003 through 20532 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

**(e) Reason**

This AD was prompted by a recent design review of the equipment racks which revealed that the left-hand side (LHS) and right-hand side (RHS) equipment racks were not designed to support the actual weight of all the equipment and the secondary direct current power centers under all loading conditions. We are issuing this AD to prevent structural failure of the LHS or RHS equipment racks in the event of a high energy emergency landing or runway excursion, which could result in blockage of the emergency exit for the flightcrew.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Modification of the Equipment Racks**

Within 90 months after the effective date of this AD, do the modification required by paragraph (g)(1) or (g)(2) of this AD, as applicable.

(1) For airplanes having S/Ns 20003 through 20500 inclusive: Modify the equipment racks having part numbers (P/Ns) K1000070316–003 (LHS) and K1000070316–004 (RHS), in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 100–25–39, dated October 26, 2015.

(2) For airplanes having S/Ns 20501 through 20532 inclusive: Modify the equipment rack having P/N K1000070316–004 (RHS only), in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 350–25–002, dated October 26, 2015.

**(h) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal

inspector or local Flight Standards District Office, as appropriate. If sending information directly to the New York ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516–228–7300; fax: 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE–170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(i) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF–2016–26, dated September 14, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–9387.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone: 514–855–5000; fax: 514–855–7401; email: [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on March 14, 2017.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017–05520 Filed 3–22–17; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

**[Docket No. FAA–2016–9588; Airspace Docket No. 16–AAL–5]**

**Proposed Amendment of Class E Airspace, Soldotna, AK**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to modify Class E airspace extending upward from 700 feet above the surface

at Soldotna Airport, Soldotna, AK. After review of the airspace, the FAA found redesign is necessary due to procedure modifications. The FAA also proposes to remove the reference to the Soldotna nondirectional radio beacon (NDB) in the legal description. This action would enhance the safety and management of IFR operations at the airport.

**DATES:** Comments must be received on or before May 8, 2017.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE., West Building Ground Floor, Room W12–140, Washington, DC 20590; telephone: 1–800–647–5527, or (202) 366–9826. You must identify FAA Docket No. FAA–2016–9588; Airspace Docket No. 16–AAL–5, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays.

FAA Order 7400.11A, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC, 20591; telephone: 202–267–8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11A at NARA, call 202–741–6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

FAA Order 7400.11, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:**

Robert LaPlante, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue SW., Renton, WA 98057; telephone (425) 203–4566.

**SUPPLEMENTARY INFORMATION:****Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the