

Proposed Rules

Federal Register

Vol. 82, No. 67

Monday, April 10, 2017

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2017-0246; Directorate Identifier 2017-NM-011-AD]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 777-200 and -300 series airplanes equipped with Rolls-Royce Model RB211-Trent 800 engines. This proposed AD was prompted by reports of inadequate clearance between the thermal protection system (TPS) insulation blankets and the electronic engine control (EEC) wiring, which resulted in damaged wires. This proposed AD would require repetitive inspections of the EEC wire bundles and clips, and corrective actions if necessary. We are proposing this AD to address the unsafe condition on these products.

DATES: We must receive comments on this proposed AD by May 25, 2017.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202-493-2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0246.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0246; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Kevin Nguyen, Aerospace Engineer, Propulsion Branch, ANM-140S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6501; fax: 425-917-6590; email: kevin.nguyen@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2017-0246; Directorate Identifier 2017-NM-011-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

We have received reports of inadequate clearance between the TPS insulation blankets and the EEC wiring, which resulted in damaged wires. This condition, if not corrected, could result in in-flight shutdown of the engine, or the inability to properly control thrust, and consequent reduced controllability of the airplane.

We issued AD 2016-11-16, Amendment 39-18543 (81 FR 39547, June 17, 2016) ("AD 2016-11-16"), on May 20, 2016. Among other actions, AD 2016-11-16 requires repetitive inspections of the EEC wire bundles and clips for airplanes with certain TPS insulation blankets. Since AD 2016-11-16 was issued, we have determined that these repetitive inspections were inadvertently terminated in AD 2016-11-16 through the installation of serviceable thrust reverser (T/R) halves. We are proposing this AD to reinstate the repetitive inspections of the EEC wire bundles and clips for certain airplanes.

Related Service Information Under 14 CFR Part 51

We reviewed Boeing Service Bulletin 777-78-0082, Revision 1, dated June 15, 2015. The service information describes, among other things, procedures for repetitive inspections of the EEC wire bundles and clips, and corrective actions if necessary. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in the service information described

previously. For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2017–0246.

The phrase “corrective actions” is used in this proposed AD. Corrective actions correct or address any condition found. Corrective actions in an AD could include, for example, repairs.

Costs of Compliance

We estimate that this proposed AD affects 55 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection (required for right T/R half only).	3 work-hours × \$85 per hour = \$255 per engine per inspection cycle.	\$0	\$255 per engine per inspection cycle.	\$28,050 (2 T/R halves per airplane) per inspection cycle.

We have received no definitive data that would enable us to provide cost estimates for the repairs specified in this proposed AD. We estimate the following

costs to do any necessary replacements that would be required based on the results of the proposed inspection. We have no way of determining the number

of aircraft that might need these repairs or replacements:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Replacement of EEC wire harness	1 work-hour × \$85 per hour = \$85	\$8,500	\$8,585

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a

substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2017–0246; Directorate Identifier 2017–NM–011–AD.

(a) Comments Due Date

We must receive comments by May 25, 2017.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 777–200 and –300 series airplanes, certificated in any category, equipped with Rolls-Royce Model RB211-Trent 800 engines, on which the actions specified in Boeing Alert Service Bulletin 777–78A0094 have been incorporated, and the condition specified in either paragraph (c)(1) or (c)(2) of this AD is met.

(1) Thermal protection system (TPS) non-re-contoured insulation blankets having part numbers (P/N) 315W5115–2, –6, or –20 are installed on the thrust reverser (T/R) inner wall.

(2) Rolls Royce Modification Service Bulletin RR.211–71–H824, dated July 30, 2014, has not been incorporated on the engine.

(d) Subject

Air Transport Association (ATA) of America Code 78, Engine exhaust.

(e) Unsafe Condition

This AD was prompted by reports of inadequate clearance between the TPS insulation blankets and the electronic engine

control (EEC) wiring, which resulted in damaged wires. We are issuing this AD to detect and correct damaged wires, which could result in in-flight shutdown of the engine, or the inability to properly control thrust, and consequent reduced controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Repetitive EEC Wire Bundle Inspection

Within 2,000 flight hours since the most recent EEC wire bundle inspection done as specified in Boeing Special Attention Service Bulletin 777-78-0071; or Boeing Service Bulletin 777-78-0082; or within 500 flight hours after the effective date of this AD, whichever occurs later: Do a detailed inspection for damage of the EEC wire bundles and clips, and do all applicable corrective actions, in accordance with the Accomplishment Instructions of Boeing Service Bulletin 777-78-0082, Revision 1, dated June 15, 2015. Do all applicable corrective actions before further flight. Repeat the inspection thereafter at intervals not to exceed 2,000 flight hours.

(h) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using the service information specified in paragraph (h)(1) or (h)(2) of this AD.

(1) Boeing Special Attention Service Bulletin 777-78-0071, Revision 2, dated July 23, 2013.

(2) Boeing Service Bulletin 777-78-0082, dated November 9, 2011.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(j) Related Information

(1) For more information about this AD, contact Kevin Nguyen, Aerospace Engineer, Propulsion Branch, ANM-140S, FAA, Seattle ACO, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6501; fax: 425-917-6590; email: kevin.nguyen@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on March 27, 2017.

Michael Kaszycki,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2017-06800 Filed 4-7-17; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2017-0142; Directorate Identifier 2016-SW-013-AD]

RIN 2120-AA64

Airworthiness Directives; Agusta S.p.A.

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for Agusta S.p.A. Model A109S helicopters. This proposed AD is prompted by a report of a cabin liner detaching from the helicopter and hitting the main rotor (M/R) blades during flight. This proposed AD would require adding limitations to the rotorcraft flight manual (RFM). The proposed actions are intended to prevent an unsafe condition on these products.

DATES: We must receive comments on this proposed AD by June 9, 2017.

ADDRESSES: You may send comments by any of the following methods:

- **Federal eRulemaking Docket:** Go to <http://www.regulations.gov>. Follow the online instructions for sending your comments electronically.
- **Fax:** 202-493-2251.
- **Mail:** Send comments to the U.S. Department of Transportation, Docket Operations, M-30, West Building

Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590-0001.

- **Hand Delivery:** Deliver to the "Mail" address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0142; or in person at the Docket Operations Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the European Aviation Safety Agency (EASA) AD, the economic evaluation, any comments received, and other information. The street address for the Docket Operations Office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

For service information identified in this proposed rule, contact AgustaWestland, Product Support Engineering, Via del Gregge, 100, 21015 Lonate Pozzolo (VA) Italy, ATTN: Maurizio D'Angelo; telephone 39-0331-664757; fax 39 0331-664680; or at <http://www.agustawestland.com/technical-bulletins>. You may review the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy, Room 6N-321, Fort Worth, TX 76177.

FOR FURTHER INFORMATION CONTACT: Matt Fuller, Senior Aviation Safety Engineer, Safety Management Group, Rotorcraft Directorate, FAA, 10101 Hillwood Pkwy, Fort Worth, TX 76177; telephone (817) 222-5110; email matthew.fuller@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to participate in this rulemaking by submitting written comments, data, or views. We also invite comments relating to the economic, environmental, energy, or federalism impacts that might result from adopting the proposals in this document. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. To ensure the docket does not contain duplicate comments, commenters should send only one copy of written comments, or if comments are filed electronically, commenters should submit only one time.